


Service Record Details

For your
2002 4Runner

VIN: JT3HN86R020389545

Mileage: 106,078

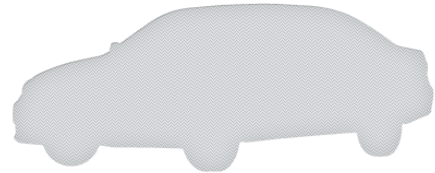

Date of Service 7/3/2013	Repair Order # 0351147	Provider Hartford Toyota 135 West Service Road Hartford, CT 06120 (860) 278-5411	Customer D Palm
	Service Type Dealer		

Job	Date	Operation	Payment						
1	7/3/2013	<p>CHECK ENGINE LIGHT</p> <p>CHECK ENGINE LIGHT - -CUSTOMER STATES CHECK ENGINE LIGHT IS ON - -TECH SCANNED ECU AND EVAP CODES FOR VENT CONTROL MALFUNCTION PERFORMED EVAP TEST AND PURGE VALVE IS OK. CLOSED CANISTER VALVE IS OK. CHECKED FOR LEAKS-NONE FOUND. CHECKED CANISTER AND FOUND TANK-BY-PASS VALVE TO BE NO GOOD. NEEDS CANISTER AND WILL NEED TO - -EXTRACARE CLAIM VSA2UC8256 TECH REMOVED AND REPLACED THE CHARCOAL CANISTER CLEARED THE CHECK ENGINE LIGHT. ROAD TESTED VEHICLE ALL IS OK AT AT THIS TIME</p> <p>Parts</p> <table border="1"> <thead> <tr> <th>Name</th> <th>Part #</th> <th>Qty</th> </tr> </thead> <tbody> <tr> <td>CANISTER ASSY, CHARC</td> <td>7774035482</td> <td>1</td> </tr> </tbody> </table>	Name	Part #	Qty	CANISTER ASSY, CHARC	7774035482	1	Customer Pay
Name	Part #	Qty							
CANISTER ASSY, CHARC	7774035482	1							
2	7/3/2013	<p>WEATHERSTRIPS</p> <p>WEATHERSTRIPS - -WEATHERSTRIP TO THE PASSENGERSIDE REAR DOOR FRAME IS COMING OFF PRICE ESTIMATE FOR REPLACMENT - -WEATEHRSTRIP WILL NEED TO BE REPLACED. - -CUSTOMER DECLINED REPAIRS AT THIS TIME</p>	Customer Pay						

Job	Date	Operation	Payment
-----	------	-----------	---------

3 7/3/2013 **QUICK SERVICE** **Customer Pay**

QUICK SERVICE -|-FUEL CAP FOR VEHICLE -|-RECOMMENDED WITH CANISTER ASSEMBLY -|
-FUEL CAP INSTALLED

Parts

Name	Part #	Qty
CAP ASSY, FUEL TANK	7730053010	1